4 Wiring diagrams

4 - 1 Wiring Diagrams - Single Phase

MC55W/MC55VB

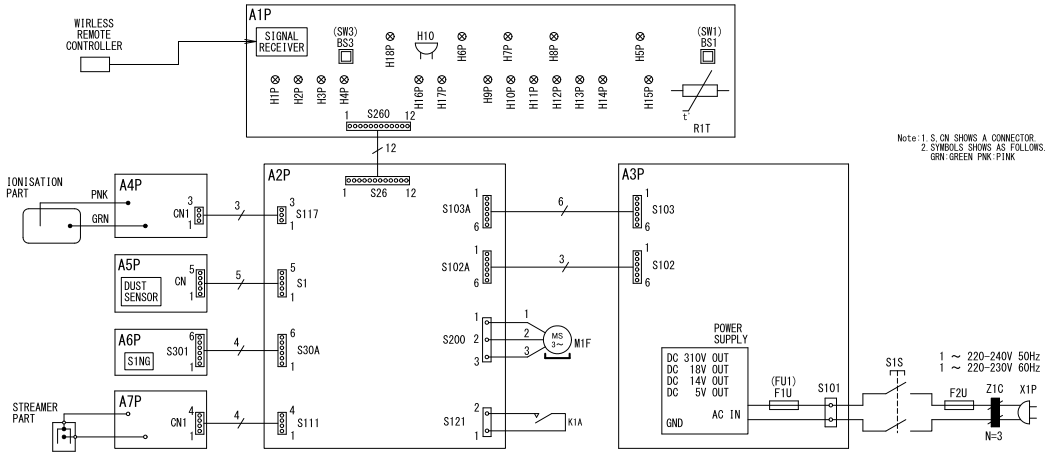

H1O	BUZZER(RECEIVING SIGN)	BS1	MAIN SWITCH	H9P	LED(PM2.5 INDICATOR 1:WHITE)	F1U	FUSE(250V,3.15A)
A1P	PRINTED CIRCUIT BOARD(FOR DISPLAY)	BS3	AIRFLOW SWITCH	H10P	LED(PM2.5 INDICATOR 2:WHITE)	F2U	FUSE(250V,3.15A)
A2P	PRINTED CIRCUIT BOARD(FOR CONTROL)	H1P	LED(QUIET:GREEN)	H11P	LED(PM2.5 INDICATOR 3:WHITE)	M1F	FAN MOTOR
A3P	PRINTED CIRCUIT BOARD(FOR POWER SUPPLY)	H2P	LED(L:GREEN)	H12P	LED(PM2.5 INDICATOR 4:WHITE)	R1T	THERMISTOR
A4P	PRINTED CIRCUIT BOARD(HIGH VOLTAGE POWER SUPPLY FOR IONISATION)	H3P	LED(S:GREEN)	H13P	LED(PM2.5 INDICATOR 5:WHITE)	K1A	LIMIT SWITCH
A5P	PRINTED CIRCUIT BOARD(FOR DUST SENSOR)	H4P	LED(TURBO:GREEN)	H14P	LED(PM2.5 INDICATOR 6:WHITE)	S1S	SAFETY SWITCH
A6P	PRINTED CIRCUIT BOARD(FOR ODOUR SENSOR)	H5P	LED(ON/OFF:GREEN)	H15P	LED(STREAMER LAMP:BLUE)	Z1C	FERRITE CORE
A7P	PRINTED CIRCUIT BOARD(FOR HIGH VOLTAGE POWER SUPPLY)	H6P	LED(AUTO FAN:GREEN)	H16P	LED(DUST SIGN:RED/GREEN)	X1P	POWER SUPPLY PLUG
S1NG	ODOUR SENSOR	H7P	LED(ECONO:GREEN)	H17P	LED(ODOUR SIGN:RED/GREEN)		
		H8P	LED(ANTI-POLLEN:GREEN)	H18P	LED(CHILD PROOF LOCK:ORANGE)		

3D110237C